

SERVICE BULLETIN 2008 – 05


14700 Aerospace Pkwy * Orlando, FL 32832 * Phone 407-855-4141 * Fax (Customer Care) 407-858-2545

TO: ALL CORRECT CRAFT DEALERS
RE: FCT2 (Titan) HINGE ASSEMBLY

October 27, 2008

We have heard of a few instances of the FCT2 hinge joint becoming loose. If this issue is brought to your attention:

1. **Confirm the proper placement of the hinge hardware as pictured below.**
2. If the hardware is loose, apply Loctite "Blue" 242 to the socket screw and tighten to 40 foot pounds.

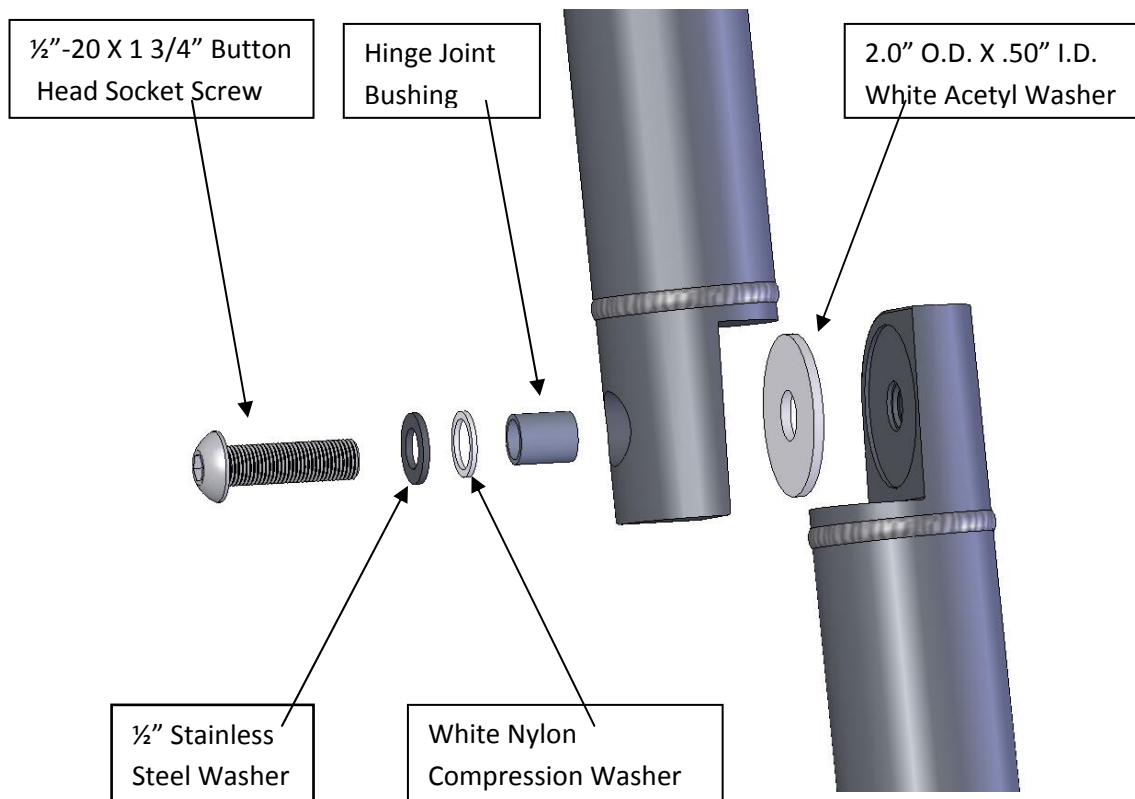

NOTE: The 1/2" Stainless Steel washer should be assembled to the outside of the White Nylon Compression Washer. This allows the White Nylon Compression Washer to be trapped and compressed into the hinge counter bore. Failure to assemble the Hinge Joints in this way will cause failure of the White Nylon Compression Washer; this may possibly reduce the performance of the Tower shortening the life of the hinge joint.

CORRECT CRAFT, INC.